

Service News

Suggestion of Maintenance
for Safety and Relief
For the safe use of Sekigahara Product

SSN-016

[SUBJECT] Countermeasure for prevent the accident by misoperation.

Precaution Information

1. Applied model

SFC21063EH SFC22055ES
SFC25055EN


2. Date of manufacture

From 2015 ~ 2019

3. Outline

Normal procedure;
After davit arm is brought back to stowing position (stopping position by limit switch), hoisting hooks are hooked directly to lashing eye and giving tension a little bit to the fall wire for eliminating the slack.

⚠ Misoperation;
At the time of next operation, **in case of forgetting to unhook the lashing before hoisting up or luffing up operation, it will cause overload which lead to damage to electric jack.**

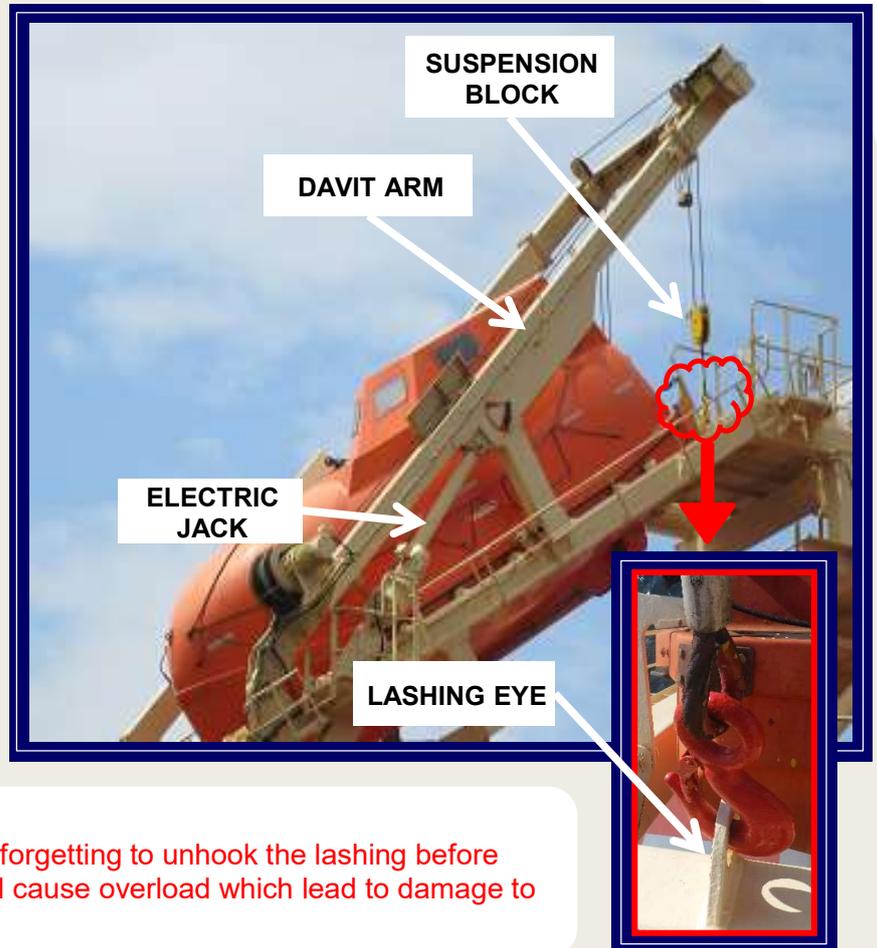

4. Prevention of accident

It is suggested to use dia 12mm nylon rope between hook and eye plate like a fuse as is shown in the photo. Even if mis-operation happens, it is only a matter of breakage of this rope.



Nylon rope (Cremona rope)
φ12 L=1000



Tie both end rope rings to the eye plates as is shown in the photo. This can avoid loosening or falling of the rope during davit operation.